

## dsPIC33EPXXXGS70X/80X Family Silicon Errata and Data Sheet Clarification

The dsPIC33EPXXXGS70X/80X family devices that you have received conform functionally to the current Device Data Sheet (DS70005258C), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in [Table 1](#). The silicon issues are summarized in [Table 2](#).


The errata described in this document will be addressed in future revisions of the dsPIC33EPXXXGS70X/80X silicon.

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated in the last column of [Table 2](#) apply to the current silicon revision (**B0**).

Data Sheet clarifications and corrections start on [page 15](#), following the discussion of silicon issues.

The silicon revision level can be identified using the current version of MPLAB® IDE and Microchip’s programmers, debuggers, and emulation tools, which are available at the Microchip corporate website ([www.microchip.com](http://www.microchip.com)).

For example, to identify the silicon revision level using MPLAB IDE in conjunction with a hardware debugger:

1. Using the appropriate interface, connect the device to the hardware debugger.
2. Open an MPLAB IDE project.
3. Configure the MPLAB IDE project for the appropriate device and hardware debugger.
4. Based on the version of MPLAB IDE you are using, do one of the following:
  - a) For MPLAB IDE 8, select *Programmer > Reconnect*.
  - b) For MPLAB X IDE, select *Window > Dashboard* and click the **Refresh Debug Tool Status** icon (  ).
5. Depending on the development tool used, the part number *and* Device Revision ID value appear in the **Output** window.

**Note:** If you are unable to extract the silicon revision level, please contact your local Microchip sales office for assistance.

The DEVREV values for the various dsPIC33EPXXXGS70X/80X silicon revisions are shown in [Table 1](#).

**TABLE 1: SILICON DEVREV VALUES**

Part Number	Device ID <sup>(1)</sup>	Revision ID for Silicon Revision <sup>(2)</sup>		Part Number	Device ID <sup>(1)</sup>	Revision ID for Silicon Revision <sup>(2)</sup>	
		A2	B0			A2	B0
dsPIC33EP64GS708	0x6C03	0x4001	0x4002	dsPIC33EP128GS705	0x6C30	0x4001	0x4002
dsPIC33EP64GS804	0x6C40			dsPIC33EP128GS706	0x6C12		
dsPIC33EP64GS805	0x6C60			dsPIC33EP128GS708	0x6C13		
dsPIC33EP64GS806	0x6C42			dsPIC33EP128GS804	0x6C50		
dsPIC33EP64GS808	0x6C43			dsPIC33EP128GS805	0x6C70		
dsPIC33EP128GS702	0x6C11			dsPIC33EP128GS806	0x6C52		
dsPIC33EP128GS704	0x6C10			dsPIC33EP128GS808	0x6C53		

- Note 1:** The Device IDs (DEVID and DEVREV) are located at the last two implemented addresses of configuration memory space. They are shown in hexadecimal in the format “DEVID DEVREV”.
- 2:** Refer to the “*dsPIC33EPXXXGS70X/80X Family Flash Programming Specification*” (DS70005256) for detailed information on Device and Revision IDs for your specific device.

# dsPIC33EPXXXGS70X/80X

**TABLE 2: SILICON ISSUE SUMMARY**

Module	Feature	Item Number	Issue Summary	Affected Revisions <sup>(1)</sup>	
				A2	B0
CPU	div.sd	1.	When using the signed 32-by-16-bit division instruction, div.sd, the Overflow bit is not getting set when an overflow occurs.	X	X
CPU	Variable Interrupt Latency	2.	When Variable Interrupt Latency is selected (VAR = 1), an address error trap or incorrect application behavior may occur.	X	X
CPU	DO Loop	3.	PSV access, including Table Reads or Writes in the last instruction of a DO loop, is not allowed.	X	X
ADC	ADC Sampling	4.	Under specific conditions, multi-core ADC sampling crosstalk noise might be present.	X	X
ADC	Oversampling Filter	5.	Parallel operation of the two oversampling filters results in missing data writes to the lower priority Filter Data Result register.	X	X
ADC	DNL	6.	DNL is out of specification at the mid-code boundary in Single-Ended mode.	X	X
UART	Break Character Generation	7.	The Transmit Shift Register Empty (TRMT) bit is unreliable when there are back-to-back Break character transmissions.	X	X
I <sup>2</sup> C	Client Mode	8.	The 7-bit address that matches the 10-bit upper address value (111_10xx) can never be accepted, regardless of the STRICT bit.	X	
I <sup>2</sup> C	Client Mode	9.	When data hold is enabled and software sends a NACK, a Client interrupt is occurring after the 9th clock.	X	X
SPI	Audio	10.	At start-up, the Idle state of the SDOx pin depends on the MSB of the first data packet when the Client is configured for Left/Right Justified mode.	X	X
SPI	Audio	11.	In PCM/DSP mode, if the channel width is greater than data width, the data loaded are not transmitted as per the loading sequence.	X	X
SPI	Audio	12.	In PCM/DSP mode, if the channel width is greater than data width, the state of SDOx is latched to the LSB of the data transmitted.	X	X
PTG	Debug	13.	Single-stepping of the command sequence queue when device is in Debug mode is not functional.	X	X
PTG	PTGADD/ PTGCOPY	14.	PTGADD and PTGCOPY commands do not change the counter limit values.	X	X
PTG	Software Trigger	15.	Software trigger (PTGSWT) is not cleared by hardware.	X	X
PWM	Module Enable	16.	A glitch may be observed on the PWM pins when the PWM module is enabled after assignment of pin ownership to the PWM module.	X	X
PWM	Center-Aligned Complementary	17.	Dead time between transitions of the PWMxH and PWMxL outputs may not be asserted when Swap mode is disabled.	X	X
PWM	Master Time Base Mode	18.	Changes to the PHASEx register after enabling the PWM module may result in abnormal PWM switching waveforms.	X	X
PWM	Push-Pull Mode	19.	When EIPU = 1, Period register writes may produce back-to-back pulses under certain conditions.	X	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

# dsPIC33EPXXXGS70X/80X

**TABLE 2: SILICON ISSUE SUMMARY (CONTINUED)**

Module	Feature	Item Number	Issue Summary	Affected Revisions <sup>(1)</sup>	
				A2	B0
PWM	Redundant/ Push-Pull Output Mode	20.	Changing the duty cycle value from a non-zero value to zero will produce a glitch pulse equal to one PWM clock.	X	X
PWM	Trigger Compare Match	21.	The first PWM/ADC trigger event on a TRIGx/STRIGx match may not occur under certain conditions.	X	X
I/O	5V Tolerant	22.	Limited number of I/O pins support 5V operation.	X	X
I/O	5V Tolerant	23.	Limit input current to I/O pins that support 5V operation.	X	X
Auxiliary PLL	APLL Lock	24.	The APLL lock bit is asserted directly after enabling the APLL.	X	X
I <sup>2</sup> C	Client Mode	25.	In Client mode, false bus collision triggers are generated during reception of a Stop bit when bus collision is enabled (SBCDE = 1).	X	
I <sup>2</sup> C	Client Mode	26.	In Client mode, the Bus Collision bit (BCL) cannot be cleared when bus collision detection is enabled (SBCDE = 1).	X	
CPU	Data Flash Reads	27.	Given a specific set of preconditions, when two or more data Flash read instructions (via Program Space Visibility (PSV) read or Table Read) are executed back-to-back, one or more subsequent instructions will be misexecuted.	X	X
PWM	Push-Pull Mode	28.	PWM generators may exhibit an incorrect phase relationship when configured in Push-Pull mode.	X	X
I/O	Schmitt Trigger	29.	Schmitt Trigger output may produce glitches.	X	
I <sup>2</sup> C	I/O Voltage Threshold	30.	With SMBus disabled, the I <sup>2</sup> C V <sub>IL</sub> (Max) threshold may be lower than 0.3 V <sub>DD</sub> .	X	X
PLL	Lock	31.	PLL out of specification during clock switch.	X	X

**Note 1:** Only those issues indicated in the last column apply to the current silicon revision.

# dsPIC33EPXXXGS70X/80X

## Silicon Errata Issues

**Note:** This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current. Only the issues indicated by the shaded column in the following tables apply to the current silicon revision (**A2**).

### 1. Module: CPU

When using the Signed 32-by-16-bit Division instruction, `div.sd`, the Overflow bit may not always get set when an overflow occurs.

This erratum only affects operations in which at least one of the following conditions is true:

- Dividend and divisor differ in sign,
- Dividend > 0x3FFFFFFF or
- Dividend < 0xC0000000.

#### Work around

The application software must perform both the following actions in order to handle possible undetected overflow conditions:

- The value of the dividend must always be constrained to be in the following range:  
 $0xC0000000 \leq \text{Dividend} \leq 0x3FFFFFFF$ .
- If the dividend and divisor differ in sign (e.g., dividend is negative and divisor is positive), then after executing the `div.sd` instruction or the compiler built-in function, `__builtin_divsd()`, inspect the sign of the resultant quotient.

If the quotient is found to be a positive number, then treat it as an overflow condition.

#### Affected Silicon Revisions

A2	B0						
X	X						

### 2. Module: CPU

An address error trap or incorrect application behavior may occur if the variable exception processing latency is enabled by setting the VAR bit (`CORCON[15] = 1`).

#### Work around

Enable the Fixed Interrupt Latency mode by clearing the VAR bit (`CORCON[15] = 0`).

#### Affected Silicon Revisions

A2	B0						
X	X						

### 3. Module: CPU

Table Write (`TBLWTL`, `TBLWTH`) instructions cannot be the first or last instruction of a `DO` loop.

#### Work around

None.

#### Affected Silicon Revisions

A2	B0						
X	X						

### 4. Module: ADC

When using multiple ADC cores, if one of the ADC cores completes conversion while the other ADC cores are still converting, the data in the ADC cores which are converting may be randomly corrupted.

#### Work around for Revision A2

**Work around 1:** When using multiple ADC cores, the ADC triggers must be sufficiently staggered in time to ensure that the end of conversion of one or more cores doesn't occur during the conversion process of other cores.

**Work around 2:** For simultaneous conversion requirements, make sure the following conditions are met:

- All the ADC cores for simultaneous conversion should have the same configurations.
- Avoid shared ADC core conversion with any of the dedicated ADC cores; they can be sequential.
- The trigger to initiate ADC conversion should be from the same source and at the same time.

#### Work around for Revision B0

Revision B0 implements an additional bit, NRE (`ADCON1[7]`). By setting the NRE bit, the end of conversions between the ADC cores are automatically staggered in the hardware. This eliminates the random result corruption issue.

#### Affected Silicon Revisions

A2	B0						
X	X						

## 5. Module: ADC

If both oversampling filters are configured identically and have different input channel selections (FLCHSEL[4:0] bits in the ADFLxCON register) and the channels start conversion from the same trigger source, then the lower priority filter result will not be written to the Filter Output Data register. Both data registers will contain the result from the higher priority filter (i.e., ADFL0DAT).

### Work around

Ensure oversampling filters have input channels with different trigger sources and do not complete conversions simultaneously.

### Affected Silicon Revisions

A2	B0						
X	X						

## 6. Module: ADC

When the ADC SAR core is configured to operate in Single-Ended mode, the core's DNL performance may be out of specification at the mid-code boundary.

### Work around

None.

### Affected Silicon Revisions

A2	B0						
X	X						

## 7. Module: UART

The Transmit Shift Register Empty (TRMT) bit is unreliable when there are back-to-back Break character transmissions.

For back-to-back Break characters, the TRMT bit may not reflect the actual status. If user software is polling for this bit to be set, it may result in dummy bytes getting transmitted instead of Break characters.

### Work around

Poll the UARTx Transmit Break bit, UTXBRK (UxSTA[11]), to be cleared instead of the TRMT bit (UxSTA[8]) to be set. The UTXBRK status bit will be cleared after a Break character transmission.

### Affected Silicon Revisions

A2	B0						
X	X						

## 8. Module: I<sup>2</sup>C

In 7-Bit Addressing mode, the I<sup>2</sup>C module will not respond to the 7-bit address that matches with the upper byte of the 10-bit address.

If the 7-bit address matches with the upper byte of the 10-bit address, the I<sup>2</sup>C module will send a NACK, irrespective of the STRICT bit setting.

### Work around

None.

### Affected Silicon Revisions

A2	B0						
X							

## 9. Module: I<sup>2</sup>C

In Client mode with DHEN = 1 (Data Hold Enable), if software sends a NACK, the Client interrupt is asserted at the 9th falling edge of the clock.

### Work around

Software should ignore the Client interrupt that is asserted after sending a NACK.

### Affected Silicon Revisions

A2	B0						
X	X						

## 10. Module: SPI

When the SPI is a Client and configured for Left Justified or Right Justified mode at start-up, the Idle state of the SDOx pin will be configured by the Most Significant bit (MSb) of the first data packet loaded to the buffer.

For example:

If data loaded to the buffer are 0xA5A5 (where MSb is '1'), then at start-up, the Idle state of SDOx will be HIGH.

If data loaded to the buffer are 0x5A5A (where MSb is '0'), then at start-up, the Idle state of SDOx will be LOW.

### Work around

None.

### Affected Silicon Revisions

A2	B0						
X	X						

# dsPIC33EPXXXGS70X/80X

## 11. Module: SPI

When the SPI is configured for PCM/DSP mode and  $\text{MODE}[32,16] = 1$  or  $\text{MODE}[32,16] = 3$ , the data loaded are not transmitted as per sequence. For example, if the data are loaded as 0x8880, 0x8881, 0x8882, 0x8883, ..., 0x8887, the transmitted data may be 0x8880, 0x8881, 0x8883, 0x8884, 0x8886, 0x8887.

### Work around

None.

### Affected Silicon Revisions

A2	B0							
X	X							

## 12. Module: SPI

When the SPI is configured for PCM/DSP mode and  $\text{MODE}[32,16] = 1$  or  $\text{MODE}[32,16] = 3$ , after completion of transmission of each data byte, the SDOx pin state is the same as the LSb of the data.

For example:

If data were 0x8880 (where LSb is '0'), the state of SDOx will be LOW after transmission.

If data were 0x8881 (where LSb is '1'), the state of SDOx will be HIGH after transmission.

### Work around

None.

### Affected Silicon Revisions

A2	B0							
X	X							

## 13. Module: PTG

In Debug mode, the following features do not work:

- Single-stepping through the command sequence queue, which is enabled by setting PTGSSEN (PTGCST[9]).
- Step interrupt, which is generated after each step execution in the queue.

### Work around

None.

### Affected Silicon Revisions

A2	B0							
X	X							

## 14. Module: PTG

PTGADD/PTGCOPY commands, which add the contents of PTGADJ, or copy the content of PTGHOLD to the Loop Counter Limit registers (PTGC0LIM and PTGC1LIM) do not work.

Although the loop counter value gets updated, the loop does not repeat as required.

### Work around

None.

### Affected Silicon Revisions

A2	B0							
X	X							

## 15. Module: PTG

The PTG Software Trigger bit, PTGSWT (PTGCST[10]), is not automatically cleared by hardware upon completion of the PTGCTRL command.

### Work around

Manually clear the PTGSWT bit (PTGCST[10]) after execution of the PTG software trigger.

### Affected Silicon Revisions

A2	B0							
X	X							

## 16. Module: PWM

The PENH and PENL bits in the IOCONx register are used to assign ownership of the pins to either the PWM module or the GPIO module. The correct procedure to configure the PWM module is to first assign pin ownership to the PWM module and then enable it using the PTEN bit in the PTCN register.

If the PWM module is enabled using the above sequence, then a glitch may be observed on the PWM pins before the actual switching of the PWM outputs begins. This glitch may cause a momentary turn-on of power MOSFETs that are driven by the PWM pins and may cause damage to the application hardware.

### Work around

Perform the following steps to avoid any glitches from appearing on the PWM outputs at the time of enabling:

1. Configure the respective PWM pins to digital inputs using the TRISx registers. This step will put the PWM pins in a high-impedance state. The PWM outputs must be maintained in a safe state by using pull-up or pull-down resistors.

2. Assign pin ownership to the GPIO module by configuring the PENH bit (IOCONx[15] = 0) and the PENL bit (IOCONx[14] = 0).
3. Specify the PWM override state to the desired safe state for the PWM pins using the OVRDAT[1:0] bits field in the IOCONx register.
4. Override the PWM outputs by setting the OVRENH bit (IOCONx[9]) = 1 and the OVRENL bit (IOCONx[8]) = 1.
5. Enable the PWM module by setting the PTEN bit (PTCN[15]) = 1.
6. Remove the PWM overrides by making the OVRENH bit (IOCONx[9]) = 0 and the OVRENL bit (IOCONx[8]) = 0.
7. Ensure a delay of at least one full PWM cycle.
8. Assign pin ownership to the PWM module by setting the PENH bit (IOCONx[15]) = 1 and the PENL bit (IOCONx[14]) = 1.

The code in [Example 1](#) illustrates the use of this work around.

### Affected Silicon Revisions

A2	B0						
X	X						

## EXAMPLE 1: CONFIGURE PWM MODULE TO PREVENT GLITCHES ON PWM1H AND PWM1L PINS AT THE TIME OF ENABLING

```

TRISAbits.TRISA4 = 1;    // Configure PWM1H/RA4 as digital input
                        // Ensure output is in safe state using pull-up or pull-down resistors
TRISAbits.TRISA3 = 1;    // Configure PWM1L/RA3 as digital input
                        // Ensure output is in safe state using pull-up or pull-down resistors

IOCON1bits.PENH = 0;    // Assign pin ownership of PWM1H/RA4 to GPIO module
IOCON1bits.PENL = 0;    // Assign pin ownership of PWM1L/RA3 to GPIO module

IOCON1bits.OVRDAT = 0;  // Configure PWM outputs override state to the desired safe state

IOCON1bits.OVRENH = 1;  // Override PWM1H output
IOCON1bits.OVRENL = 1;  // Override PWM1L output

PTCONbits.PTEN = 1;    // Enable PWM module

IOCON1bits.OVRENH = 0;  // Remove override for PWM1H output
IOCON1bits.OVRENL = 0;  // Remove override for PWM1L output

Delay(x);              // Introduce a delay greater than one full PWM cycle

IOCON1bits.PENH = 1;    // Assign pin ownership of PWM1H/RA4 to PWM module
IOCON1bits.PENL = 1;    // Assign pin ownership of PWM1L/RA3 to PWM module
    
```

# dsPIC33EPXXXGS70X/80X

---

## 17. Module: PWM

In Center-Aligned Complementary mode with Independent Time Base, the expected dead time between transitions of the PWMxH and PWMxL outputs may not be asserted when SWAP is disabled under the following conditions:

- PWMx module is enabled (PTEN = 1)
- SWAP is enabled prior to this event

### Work around

None.

### Affected Silicon Revisions

A2	B0						
X	X						



## 18. Module: PWM

In Edge-Aligned Complementary mode, with Master Time Base selected ( $PWMCONx[9] = 0$ ), a reduction in phase shift, such that  $PHASEx$  becomes less than  $DTRx$  (or  $PDCx$ ), will result in an abnormal PWM pulse at the next master period boundary.

Similarly, an increase in phase shift, such that  $PHASEx$  becomes greater than  $DTRx$  (or  $PDCx$ ), will result in a reduced dead time for one PWM cycle at the next master period boundary. The amount of dead time is shown in [Table 3](#).

In addition, dead time may also be impacted when updates to the Phase-Shift register occur while operating below the defined dead-time region.

With immediate updates disabled ( $PWMCONx[0] = 0$ ), the abnormal pulse or reduced dead time may appear at the second master period boundary from when the write to  $PHASEx$  occurred.

[Table 3](#) summarizes the expected PWM event that occurs at the master PWM period boundary when  $PHASEx$  is updated.

**TABLE 3: EXPECTED PWM EVENTS**

Condition	Event at Master Period Boundary	Result
$PHASEx < PHASEx_{(new)} < DTRx$	Reduced Dead Time	Dead Time = $DTRx - (PHASEx_{(new)} - PHASEx_{(old)})$
$PHASEx > PHASEx_{(new)} < DTRx$	Increased Dead Time	Dead Time = $DTRx + (PHASEx_{(old)} - PHASEx_{(new)})$
$PHASEx < DTRx, PHASEx_{(new)} > DTRx$	Reduced Dead Time	Dead Time = $PHASEx_{(old)}$
$PHASEx < PDCx, PHASEx_{(new)} > PDCx$	Reduced Dead Time	Dead Time = $PDCx + DTRx - PHASEx_{(new)}$
$PHASEx > DTRx, PHASEx_{(new)} < DTRx$	Abnormal PWM Pulse	Abnormal Pulse Width = $PHASEx_{(new)} - DTRx$
$PHASEx > PDCx, PHASEx_{(new)} < PDCx$	Abnormal PWM Pulse	Abnormal Pulse Width and Possibility for Reduced Dead Time (Zero Dead Time)

### Work around

When modifying the  $PHASEx$  register on-the-fly, bound the  $PHASEx$  register to the following conditions:  $DTRx < PHASEx < PDCx$ .

### Affected Silicon Revisions


A2	B0						
X	X						

# dsPIC33EPXXXGS70X/80X

## 19. Module: PWM

When the PWM module is configured for Push-Pull mode (IOCONx[11:10] = 0b10) with the Enable Immediate Period Update bit enabled (PTCON [10] = 1), a write to the Period register that coincides with the period rollover event may cause the push-pull output logic to produce back-to-back pulses on the PWMx pins (see Figure 1).

FIGURE 1:

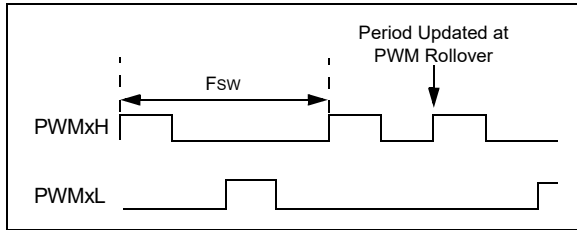

### Work around

Ensure that the update to the PWM Period register occurs away from the PWM rollover event by setting the EIPU bit (PTCON[10] = 1). Use either the PWM Special Event Trigger (SEVTCMP) or the PWM Primary Trigger (TRIGx) to generate a PWM Interrupt Service Routine (ISR) near the start of the PWM cycle. This ISR will ensure that period writes do not occur near the PWM period rollover event.


### Affected Silicon Revisions

A2	B0						
X	X						

## 20. Module: PWM

In the Redundant Output mode (IOCONx[11:10] = 0b01) and Push-Pull Output mode (IOCONx[11:10] = 0b10), with the Immediate Update Enable bit disabled (PWMCONx[0] = 0), when the Duty Cycle register is updated from a non-zero value to zero, a glitch pulse of a width equal to 1 PWM clock will appear at the next PWM period boundary, as shown in Figure 2 (for the Redundant Output mode). The Duty Cycle register refers to the PDCx register if PWMCONx[8] = 0 or the MDC register if PWMCONx[8] = 1.

FIGURE 2: EXAMPLE FOR REDUNDANT OUTPUT MODE

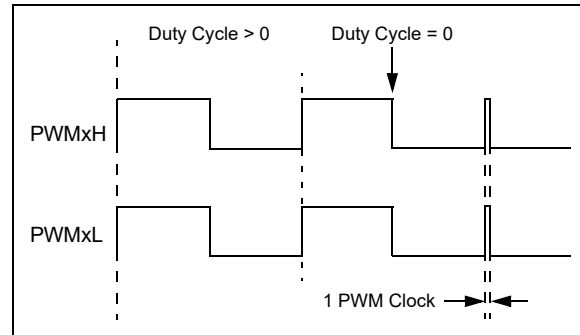

### Work around

If the application requires a zero duty cycle output, there are two possible work around methods:

1. Use the PWM override feature to override the PWM output to a low state instead of writing to the Duty Cycle register. In order to switch back to a non-zero duty cycle output, turn off the PWM override. The override-on and override-off events must be timed close to the PWM period boundary if the IOCONx register has been configured with IOCONx[0] = 0 (i.e., output overrides through the OVRDAT[1:0] bits occur on the next CPU clock boundary).
2. Enable the Immediate Update Enable bit (PWMCONx[0] = 1) while configuring the PWMx module (i.e., before enabling the PWMx module, PTCON[15] = 1). With the Immediate Update enabled, writes to the Duty Cycle register can have an immediate effect on the PWM output. Therefore, the duty cycle write operations must be timed close to the PWM period boundary in order to avoid distortions in the PWM output.

### Affected Silicon Revisions

A2	B0						
X	X						

## 21. Module: PWM

The triggers generated by the PWMx Primary Trigger Compare Value register (TRIGx) and the PWMx Secondary Trigger Compare Value register (STRIGx) will not trigger at the point defined by the TRIGx/STRIGx register values on the first instance for the configurations listed below. Subsequent trigger instances are not affected.

- Trigger compare values for TRIGx, STRIGx are less than 8 counts
- Trigger Output Divider bits, TRGDIV[3:0] (TRGCONx[15:12]), are greater than '0'
- Trigger Postscaler Start Enable Select bits, TRGSTRT[5:0] (TRGCONx[5:0]), are equal to '0'

### Work around

Configure the PWMx Primary Trigger Compare Value Register (TRIGx) and PWMx Secondary Trigger Compare Value Register (STRIGx) values to be equal to or greater than 8.

### Affected Silicon Revisions

A2	B0						
X	X						

## 22. Module: I/O

Only the following four I/O ports support 5V operation: RC7, RC8, RB8 and RB15. All other I/O ports support 3.3V operation.

### Work around

None.

### Affected Silicon Revisions

A2	B0						
X	X						

## 23. Module: I/O

Undesired pin failure may occur on 5V tolerant I/O pins (RC7, RC8, RB8 and RB15).

### Work around

If 5V input operation is desired on RC7, RC8, RB8 and RB15, use a current-limiting resistor of at least 1 kOhm.

### Affected Silicon Revisions

A2	B0						
X	X						

## 24. Module: Auxiliary PLL

The Auxiliary PLL Locked Status bit, APLLCK (ACLKCON[14]), is asserted directly after enabling the APLL module (ACLKCON[15]).

### Work around

Add a 50  $\mu$ s delay routine after enabling the APLL Lock bit.

### Affected Silicon Revisions

A2	B0						
X	X						

## 25. Module: I<sup>2</sup>C

In Client mode, false bus collision triggers are generated when the bus collision is enabled (SBCDE = 1) and a Stop bit is received.

### Work around

Ignore the bus collision. Disable the I<sup>2</sup>C module and then re-enable the module.

### Affected Silicon Revisions

A2	B0						
X							

## 26. Module: I<sup>2</sup>C

In Client mode, the Bus Collision bit (BCL) cannot be cleared when bus collision detection is enabled (SBCDE = 1).

### Work around

Disable the I<sup>2</sup>C module and then re-enable the module.

### Affected Silicon Revisions

A2	B0						
X							

# dsPIC33EPXXXGS70X/80X

## 27. Module: CPU

**Note:** This issue is deterministic based on the instruction sequence executed, and is not sensitive to manufacturing process, temperature, voltage or other application operating conditions that do not affect the instruction sequence.


When two or more data Flash read instructions (via Program Space Visibility (PSV) read or Table Read) are executed back-to-back, one or more subsequent instructions can be misexecuted when all of the conditions in [Table 4](#) occur.

**TABLE 4: REQUIRED CONDITIONS**

1. A PSV <code>MOV.D</code> instruction is executed, with opcode at address ending in 0x0, 0x4, 0x8 or 0xC; and
2. Some “connecting code” is executed (following the <code>MOV.D</code> of condition 1), with the properties: <ul style="list-style-type: none"><li>a) The connecting code does not include any program flow changes, including: taken branch instructions (including all versions of <code>BRA</code>, <code>CPBEQ</code>, <code>CPBGT</code>, <code>CPBLT</code>, <code>CPBNE</code>), <code>CALL</code>, <code>CALL.L</code>, <code>GOTO</code>, <code>GOTO.L</code>, <code>RCALL</code>, <code>RETLW</code>, <code>RETURN</code>, vectoring to an ISR, returning from an interrupt (<code>RETFIE</code>) and certain debug operations, such as break and one-step; and</li><li>b) The connecting code does not include a <code>TBLRDx</code> or non-<code>MOV.D</code> PSV instruction, located at a Flash memory address ending in 0x0, 0x4, 0x8 or 0xC; and</li><li>c) The connecting code is at least two instruction words in length; and</li><li>d) The connecting code does not end with a <code>REPEAT</code> instruction, with count &gt; 0; and</li></ul>
3. $\geq 2$ back-to-back PSV or <code>TBLRDx</code> instructions are executed (following the code of condition 2), where the first of the back-to-back instructions is located at an address ending in 0x2, 0x6, 0xA or 0xE.

[Figure 3](#) provides an example of the effective behavior.

**FIGURE 3: SIMPLIFIED BEHAVIOR**

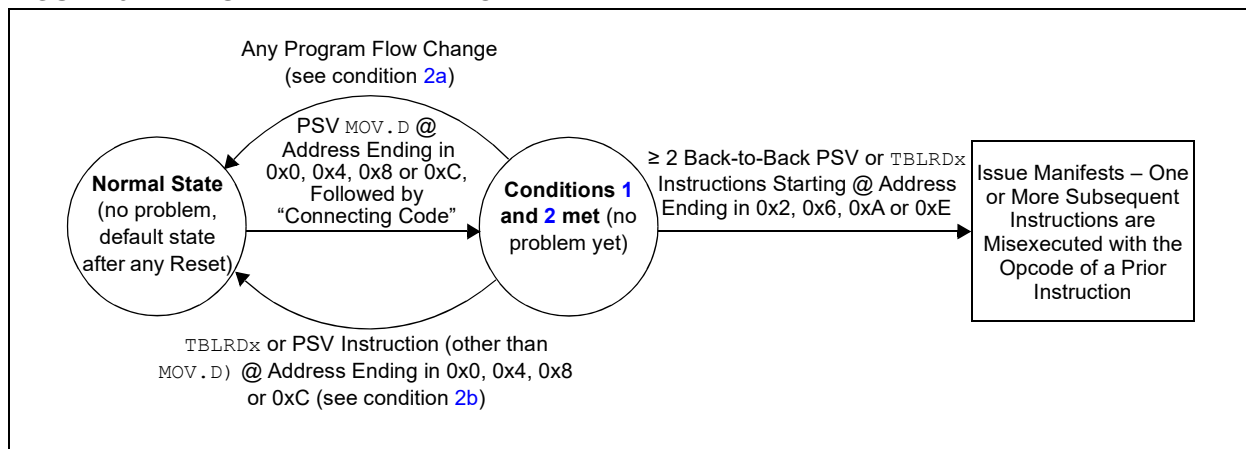

## Work around

The issue can be avoided by ensuring any one or more of the requirements are not met. For example:

1. All instances of PSV `MOV.D` can be replaced with two PSV `MOV` instructions instead. Non-PSV `MOV.D` instructions acting on RAM/SFRs do not need to be modified; or
2. If not already present, a program flow change instruction (such as `BRA $+2`) can be inserted above back-to-back data Flash read sequences; or
3. Back-to-back data Flash read instruction sequences can be broken up by inserting a non-Flash read instruction (such as a `NOP`), in between the Flash read instructions; or
4. The alignment of the code can be shifted to avoid the required opcode location addresses.

C code built with MPLAB® XC16 Compiler Version 1.32, or later, implements the work around by default. However, if the application uses Assembly language routines, these should be manually modified to implement the work around. Additionally, if precompiled libraries are used, these should be built with XC16 Version 1.32 or later. For additional information, please visit: [www.microchip.com/erratum\\_psrds\\_psrds](http://www.microchip.com/erratum_psrds_psrds)

## Affected Silicon Revisions

A2	B0						
X	X						

## 28. Module: PWM

When the PWMx Primary Phase-Shift register (`PHASEx[15:0]`) value is less than 0x0007 counts, PWM generators configured in Push-Pull mode (`IOCONx[11:10] = 0b10`) may exhibit an incorrect phase relationship compared to other PWM generators.

## Work around

Ensure that the PWMx Primary Phase-Shift register (`PHASEx[15:0]`) value is always greater than 0x0007 counts for all PWM generators configured in Push-Pull mode.

## Affected Silicon Revisions

A2	B0						
X	X						

## 29. Module: I/O

If the input signal rise or fall time is greater than 300 nS, the I/O Schmitt trigger output may have glitches.

## Work around

The rise/fall times must be less than 300 nS.

## Affected Silicon Revisions

A2	B0						
X							

## 30. Module: I<sup>2</sup>C

With SMBUS disabled (`SMEN (I2CxCONL[8]) = 0`), the I<sup>2</sup>C  $V_{IL}$  (Max) threshold may be lower than 0.3V<sub>DD</sub>.

With SMBus disabled, as per the specification (D118 parameter), Input Low Voltage maximum specification for I/O Pins with SDAx and SCLx ( $V_{IL}$  Max) should be 0.3 V<sub>DD</sub>. However, for the I<sup>2</sup>C to recognize low, the voltage should be driven to 0.8V or below.

## Work around

1. With SMBus disabled, Input Low Voltage maximum threshold ( $V_{IL}$  Max) on SDAx and SCLx should be below 0.8V.
2. With SMBus enabled with `SMEN (I2CxCONL[8]) = 1`, the  $V_{IL}$  Max is 0.8V. This voltage is closer to the 0.3 V<sub>DD</sub>.

## Affected Silicon Revisions

A2	B0						
X	X						

# dsPIC33EPXXXGS70X/80X

---

## 31. Module: PLL

When configuring the device to operate at or near maximum MIPS ( $60 < \text{MIPS} \leq 70$ ) using the on-chip PLL (Phase-Locked Loop), the PLL may temporarily be out of specification during the oscillator switchover event. This incorrect operating frequency may violate Flash access read times, which could result in instruction misexecution, such as device Reset, address error trap or incorrect branching.

### Work around

To avoid violating Flash access read times during the oscillator switchover event, the REPEAT instruction, followed by the NOP instruction, should be inserted immediately after initiating the clock switch as shown below. This instruction sequence will ensure Flash is not being read during the clock switch event. The addition of the REPEAT instruction, followed by the NOP instruction, adds only a few hundred microseconds (less than 500  $\mu\text{s}$ ) to the overall oscillator switchover event.

### EXAMPLE 2:

```
// Initiate Clock Switch to Primary Oscillator with PLL (or Fast RC Oscillator with PLL, 0x01)
__builtin_write_OSCCONH(0x03);
__builtin_write_OSCCONL(OSCCON | 0x01);

// Immediately fetch repeat and NOP instructions. NOP executed during clock switch-over event,
// Flash read occurs only once ensuring no miss-execution of instructions
__asm__("REPEAT, #0x7FFF)\n Nop");

// Wait for Clock switch to occur (0b001 for FRC w/ PLL)
while (OSCCONbits.COSC != 0b011);

// Wait for PLL to lock
while (OSCCONbits.LOCK != 1);
```

### Affected Silicon Revisions

A2	B0						
X	X						

## Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the latest version of the device data sheet (DS70005258C):

**Note:** Corrections are shown in **bold**. Where possible, the original bold text formatting has been removed for clarity.

### 1. Module: High-Speed, 12-Bit Analog-to-Digital Converter (ADC)

A new note should be added to **Register 22-26: ADTRIGxL** and **Register 22-27: ADTRIGxH**:

**Note 1:** The ADC module should be initialized and calibrated before the selected trigger source (PWM, output compare or timer) is enabled.

### 2. Module: Oscillator Configuration

The following notes have been added to **Figure 9-1: Oscillator System Diagram**:

**4:** The APLL module incorporates a new loss of lock feature that may generate a soft error trap at device power-up when the internal FRC is the reference clock. In the event the trap occurs, clearing the APLL bit (INTCON3[0]) will allow application firmware to continue executing. The APLL remains operational and within specified frequency limits. The APLL circuitry will automatically relock within 50  $\mu$ s.

**5:** If FRCSEL = 0 and the clock corresponding to POSCCLK is either not connected or has failed, then the FRC clock is selected as the clock source.

### 3. Module: Device Families

In the Device Families table on page 2, the dsPIC33EP64GS805, dsPIC33EP128GS705 and dsPIC33EP128GS805 devices have been changed from 33-pins to 36-pins.

### 4. Module: Pin Diagrams

The following footnote has been added to the pin diagrams for the TMS pin:

**Note 2:** There is an internal pull-up resistor connected to the TMS pin during POR and programming.

### 5. Module: Interrupt Controller

In **Figure 7-1**, 0x00000E has been changed to DMAC Error Trap Vector.

### 6. Module: Interrupt Controller

In **Figure 7-2**, BSLIM<12:0> + 0x00000E has been changed to DMAC Error Trap Vector.

### 7. Module: Interrupt Controller

In **Register 7-3: INTCON1**, bit 5 has been changed from Unimplemented, to:

**DMACERR:** DMAC Trap Flag bit

1 = DMAC trap has occurred

0 = DMAC trap has not occurred

### 8. Module: I/O Ports

In **Table 11-4**, all PORTD/ANSELD availability has been removed from dsPIC33EPXXXGSX04 as shown in **bold**:

TABLE 11-4: PORTD PIN AND ANSELD AVAILABILITY

Device	PORTD I/O Pins															
	RD15	RD14	RD13	RD12	RD11	RD10	RD9	RD8	RD7	RD6	RD5	RD4	RD3	RD2	RD1	RD0
dsPIC33EPXXXGSX08	X	X	X	X	X	X	X	X	X	X	X	X	X	X	X	X
dsPIC33EPXXXGSX06	X	X	X	X	X	X	X	X	X	X	X	X	X	X	X	X
dsPIC33EPXXXGSX05	—	X	—	—	—	X	—	—	—	—	—	X	—	—	—	—
dsPIC33EPXXXGSX04	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
dsPIC33EPXXXGS702	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—	—
ANSELD Bit Present	—	—	X	—	—	—	—	X	X	—	X	—	—	X	—	—

# dsPIC33EPXXXGS70X/80X

## 9. Module: Electrical Characteristics


In Table 30-53: Analog-to-Digital Conversion Timing Requirements, the following parameters have been added:

Param No.	Symbol	Characteristics	Min.	Typical	Max.	Units	Conditions
<b>Analog Input</b>							
AD60	CHOLD	Capacitance	—	5	—	pF	Dedicated cores <b>(Note 1)</b>
AD61	CHOLD	Capacitance	—	8	—	pF	Shared cores <b>(Note 1)</b>
AD62	RIC	Input Resistance	—	—	1000	Ω	<b>Note 1</b>

## 10. Module: Memory Organization

In Figure 4-2, the following changes have been made as shown in **bold**:

**FIGURE 4-2: PROGRAM MEMORY MAP FOR dsPIC33EP128GS70X/80X DEVICES**

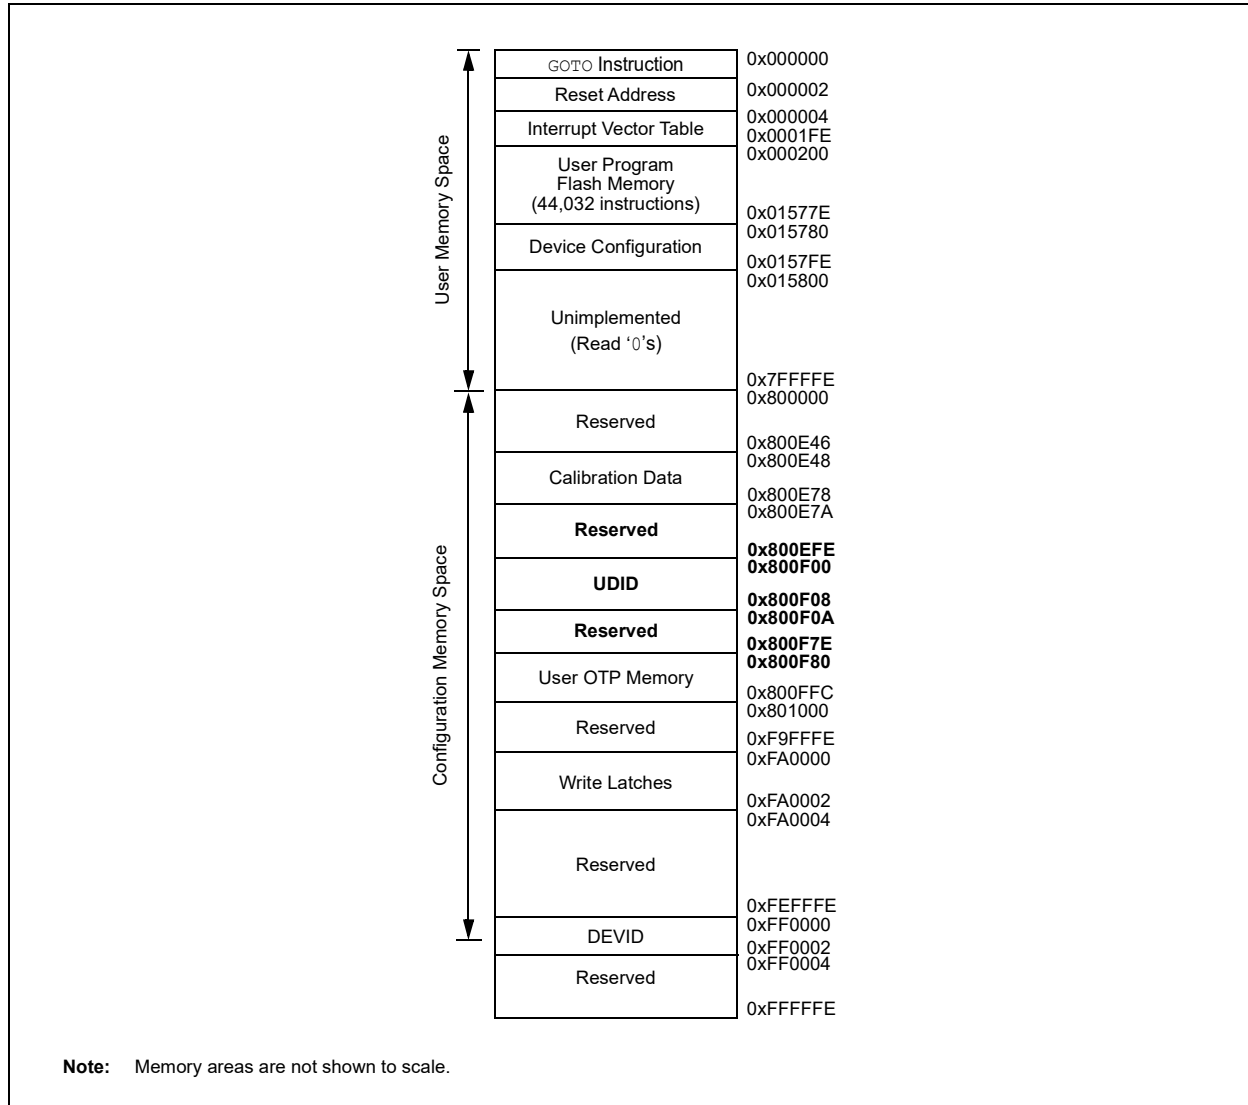



## APPENDIX A: DOCUMENT REVISION HISTORY

### Rev A Document (1/2017)

Initial release of this document; issued for Revision A2.

### Rev B Document (3/2017)

Device ID for Revision A2 has been changed from 0x4002 to 0x4001.

Added data sheet clarification 1 (Direct Memory Access (DMA)) and 2 (Flash Program Memory).

### Rev C Document (7/2017)

Updated silicon issue 18 ([PWM](#)).

Added silicon issues 25 ([I<sup>2</sup>C\), 26 \(\[I<sup>2</sup>C\\) and 27 \\(\\[CPU\\]\\(#\\)\\).\]\(#\)](#)

Added data sheet clarification 3 (Pin Diagrams), 4 (Device Overview), 5 (Constant Current Source) and 6 (High-Speed PWM).

### Rev D Document (1/2018)

Added silicon issue 28 ([PWM](#)).

### Rev E Document (10/2018)

Updated data sheet revision to 'C'.

Added silicon revision B0.

Updated silicon issue 4 ([ADC](#)).

Added silicon issue 29 ([I/O](#)).

Removed all data sheet clarifications.

### Rev F Document (2/2019)

Added silicon issue 30 ([I<sup>2</sup>C\).](#)

This revision of the document shows changed bit representation (e.g., <3:0> changed to [3:0]) to be consistent with SDL documents.

### Rev G Document (8/2019)

Adds new silicon issue 31 ([PLL](#)).

Adds data sheet clarification: 1 (High-Speed, 12-Bit Analog-to-Digital Converter (ADC)).

### Rev H Document (5/2021)

Adds data sheet clarification 2 (Oscillator Configuration).

### Rev J Document (1/2022)

Updated silicon issue 8 ([I<sup>2</sup>C\).](#)

Added data sheet clarifications 3 ([Device Families](#)), 4 ([Pin Diagrams](#)), 5 ([Interrupt Controller](#)), 6 ([Interrupt Controller](#)), 7 ([Interrupt Controller](#)), 8 ([I/O Ports](#)), 9 ([Electrical Characteristics](#)) and 10 ([Memory Organization](#)).

The I<sup>2</sup>C and SPI standards use the terminology "Master" and "Slave". The equivalent Microchip terminology used in this document is "Host" and "Client", respectively.

# dsPIC33EPXXXGS70X/80X

---

NOTES:

---

**Note the following details of the code protection feature on Microchip products:**

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is “unbreakable”. Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.

---

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at <https://www.microchip.com/en-us/support/design-help/client-support-services>.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

For information regarding Microchip's Quality Management Systems, please visit [www.microchip.com/quality](http://www.microchip.com/quality).

**Trademarks**

The Microchip name and logo, the Microchip logo, Adaptec, AnyRate, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzr, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, APT, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, IntelliMOS, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, QuietWire, SmartFusion, SyncWorld, Temux, TimeCesium, TimeHub, TimePictra, TimeProvider, TrueTime, WinPath, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, GridTime, IdealBridge, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, MultiTRAK, NetDetach, NVM Express, NVMe, Omniscient Code Generation, PICDEM, PICDEM.net, PICKit, PICtail, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQI, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, TSHARC, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, Symmcom, and Trusted Time are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2017-2022, Microchip Technology Incorporated and its subsidiaries.

All Rights Reserved.

ISBN: 978-1-5224-9583-3



# MICROCHIP

## Worldwide Sales and Service

### AMERICAS

**Corporate Office**  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 480-792-7200  
Fax: 480-792-7277  
Technical Support:  
<http://www.microchip.com/support>  
Web Address:  
[www.microchip.com](http://www.microchip.com)

#### Atlanta

Duluth, GA  
Tel: 678-957-9614  
Fax: 678-957-1455

#### Austin, TX

Tel: 512-257-3370

#### Boston

Westborough, MA  
Tel: 774-760-0087  
Fax: 774-760-0088

#### Chicago

Itasca, IL  
Tel: 630-285-0071  
Fax: 630-285-0075

#### Dallas

Addison, TX  
Tel: 972-818-7423  
Fax: 972-818-2924

#### Detroit

Novi, MI  
Tel: 248-848-4000

#### Houston, TX

Tel: 281-894-5983

#### Indianapolis

Noblesville, IN  
Tel: 317-773-8323  
Fax: 317-773-5453  
Tel: 317-536-2380

#### Los Angeles

Mission Viejo, CA  
Tel: 949-462-9523  
Fax: 949-462-9608  
Tel: 951-273-7800

#### Raleigh, NC

Tel: 919-844-7510

#### New York, NY

Tel: 631-435-6000

#### San Jose, CA

Tel: 408-735-9110  
Tel: 408-436-4270

#### Canada - Toronto

Tel: 905-695-1980  
Fax: 905-695-2078

### ASIA/PACIFIC

**Australia - Sydney**  
Tel: 61-2-9868-6733

**China - Beijing**  
Tel: 86-10-8569-7000

**China - Chengdu**  
Tel: 86-28-8665-5511

**China - Chongqing**  
Tel: 86-23-8980-9588

**China - Dongguan**  
Tel: 86-769-8702-9880

**China - Guangzhou**  
Tel: 86-20-8755-8029

**China - Hangzhou**  
Tel: 86-571-8792-8115

**China - Hong Kong SAR**  
Tel: 852-2943-5100

**China - Nanjing**  
Tel: 86-25-8473-2460

**China - Qingdao**  
Tel: 86-532-8502-7355

**China - Shanghai**  
Tel: 86-21-3326-8000

**China - Shenyang**  
Tel: 86-24-2334-2829

**China - Shenzhen**  
Tel: 86-755-8864-2200

**China - Suzhou**  
Tel: 86-186-6233-1526

**China - Wuhan**  
Tel: 86-27-5980-5300

**China - Xian**  
Tel: 86-29-8833-7252

**China - Xiamen**  
Tel: 86-592-2388138

**China - Zhuhai**  
Tel: 86-756-3210040

### ASIA/PACIFIC

**India - Bangalore**  
Tel: 91-80-3090-4444

**India - New Delhi**  
Tel: 91-11-4160-8631

**India - Pune**  
Tel: 91-20-4121-0141

**Japan - Osaka**  
Tel: 81-6-6152-7160

**Japan - Tokyo**  
Tel: 81-3-6880-3770

**Korea - Daegu**  
Tel: 82-53-744-4301

**Korea - Seoul**  
Tel: 82-2-554-7200

**Malaysia - Kuala Lumpur**  
Tel: 60-3-7651-7906

**Malaysia - Penang**  
Tel: 60-4-227-8870

**Philippines - Manila**  
Tel: 63-2-634-9065

**Singapore**  
Tel: 65-6334-8870

**Taiwan - Hsin Chu**  
Tel: 886-3-577-8366

**Taiwan - Kaohsiung**  
Tel: 886-7-213-7830

**Taiwan - Taipei**  
Tel: 886-2-2508-8600

**Thailand - Bangkok**  
Tel: 66-2-694-1351

**Vietnam - Ho Chi Minh**  
Tel: 84-28-5448-2100

### EUROPE

**Austria - Wels**  
Tel: 43-7242-2244-39  
Fax: 43-7242-2244-393

**Denmark - Copenhagen**  
Tel: 45-4485-5910  
Fax: 45-4485-2829

**Finland - Espoo**  
Tel: 358-9-4520-820

**France - Paris**  
Tel: 33-1-69-53-63-20  
Fax: 33-1-69-30-90-79

**Germany - Garching**  
Tel: 49-8931-9700

**Germany - Haan**  
Tel: 49-2129-3766400

**Germany - Heilbronn**  
Tel: 49-7131-72400

**Germany - Karlsruhe**  
Tel: 49-721-625370

**Germany - Munich**  
Tel: 49-89-627-144-0  
Fax: 49-89-627-144-44

**Germany - Rosenheim**  
Tel: 49-8031-354-560

**Israel - Ra'anana**  
Tel: 972-9-744-7705

**Italy - Milan**  
Tel: 39-0331-742611  
Fax: 39-0331-466781

**Italy - Padova**  
Tel: 39-049-7625286

**Netherlands - Drunen**  
Tel: 31-416-690399  
Fax: 31-416-690340

**Norway - Trondheim**  
Tel: 47-7288-4388

**Poland - Warsaw**  
Tel: 48-22-3325737

**Romania - Bucharest**  
Tel: 40-21-407-87-50

**Spain - Madrid**  
Tel: 34-91-708-08-90  
Fax: 34-91-708-08-91

**Sweden - Gothenberg**  
Tel: 46-31-704-60-40

**Sweden - Stockholm**  
Tel: 46-8-5090-4654

**UK - Wokingham**  
Tel: 44-118-921-5800  
Fax: 44-118-921-5820

# Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

## Microchip:

[dsPIC33EP64GS502-E/MM](#) [dsPIC33EP64GS502-E/MX](#) [dsPIC33EP64GS502-E/SO](#) [dsPIC33EP64GS502-I/MM](#)  
[dsPIC33EP64GS502-I/MX](#) [dsPIC33EP64GS502-I/SO](#) [dsPIC33EP64GS502T-I/MM](#) [dsPIC33EP64GS502T-I/MX](#)  
[dsPIC33EP64GS502T-I/SO](#) [dsPIC33EP64GS504-E/ML](#) [dsPIC33EP64GS504-E/PT](#) [dsPIC33EP64GS504-I/ML](#)  
[dsPIC33EP64GS504-I/PT](#) [dsPIC33EP64GS504T-I/ML](#) [dsPIC33EP64GS504T-I/PT](#) [DSPIC33EP64GS506-E/PT](#)  
[dsPIC33EP64GS506-I/PT](#) [dsPIC33EP64GS506T-I/PT](#) [dsPIC33EP64GS502T-E/MM](#) [dsPIC33EP64GS502T-E/SO](#)  
[dsPIC33EP64GS504T-E/ML](#) [dsPIC33EP64GS504T-E/PT](#) [dsPIC33EP64GS506T-E/PT](#) [dsPIC33EP64GS502T-I/2N](#)  
[dsPIC33EP64GS502-E/2N](#) [dsPIC33EP64GS502-I/2N](#) [dsPIC33EP64GS502T-E/2N](#) [dsPIC33EP128GS805T-I/PT](#)  
[DSPIC33EP128GS804-E/ML](#) [dsPIC33EP128GS702-E/SO](#) [dsPIC33EP128GS702T-I/2N](#) [dsPIC33EP128GS808-I/PT](#)  
[dsPIC33EP128GS708T-I/PT](#) [dsPIC33EP128GS704-I/PT](#) [dsPIC33EP128GS806-E/PT](#) [dsPIC33EP128GS708-E/PT](#)  
[dsPIC33EP128GS705T-I/PT](#) [dsPIC33EP128GS806T-I/PT](#) [dsPIC33EP128GS702-E/2N](#) [dsPIC33EP128GS805-E/PT](#)  
[dsPIC33EP128GS706-I/PT](#) [dsPIC33EP128GS704-E/PT](#) [dsPIC33EP128GS804-I/PT](#) [dsPIC33EP128GS702T-I/SO](#)  
[dsPIC33EP128GS706T-I/PT](#) [dsPIC33EP128GS808-E/PT](#) [dsPIC33EP128GS702T-I/MM](#) [dsPIC33EP128GS804-E/PT](#)  
[dsPIC33EP128GS706-E/PT](#) [dsPIC33EP128GS704-I/ML](#) [dsPIC33EP128GS806-I/PT](#) [dsPIC33EP128GS808T-I/PT](#)  
[dsPIC33EP128GS702-I/SO](#) [dsPIC33EP128GS702-E/MM](#) [dsPIC33EP128GS805-I/PT](#) [dsPIC33EP128GS704T-I/ML](#)  
[dsPIC33EP128GS702-I/2N](#) [dsPIC33EP128GS708-I/PT](#) [dsPIC33EP128GS704-E/ML](#) [dsPIC33EP128GS804T-I/ML](#)  
[dsPIC33EP128GS705-E/PT](#) [dsPIC33EP128GS804-I/ML](#) [dsPIC33EP128GS705-I/PT](#) [dsPIC33EP128GS702-I/MM](#)  
[dsPIC33EP128GS804T-I/PT](#) [dsPIC33EP128GS704T-I/PT](#) [dsPIC33EP64GS805-I/PT](#) [dsPIC33EP64GS804-E/PT](#)  
[dsPIC33EP64GS708T-I/PT](#) [dsPIC33EP64GS808-E/PT](#) [dsPIC33EP64GS808-I/PT](#) [dsPIC33EP64GS804T-I/ML](#)  
[dsPIC33EP64GS804-I/ML](#) [dsPIC33EP64GS708-E/PT](#) [dsPIC33EP64GS708-I/PT](#) [dsPIC33EP64GS805-E/PT](#)  
[dsPIC33EP64GS804-E/ML](#) [dsPIC33EP64GS806-I/PT](#) [dsPIC33EP64GS806-E/PT](#) [dsPIC33EP64GS804T-I/PT](#)  
[DSPIC33EP64GS804-I/PT](#) [dsPIC33EP64GS808T-I/PT](#) [dsPIC33EP64GS805T-I/PT](#) [dsPIC33EP64GS806T-I/PT](#)  
[dsPIC33EP64GS505-I/PT](#) [dsPIC33EP64GS505-E/PT](#) [dsPIC33EP64GS505T-E/PT](#) [dsPIC33EP64GS505T-I/PT](#)